



Purchase Order

Date	P.O. No.
6/23/2022	7509-INV

Nutrient Control Systems, Inc.
 130 Industrial Drive
 Chambersburg PA 17201
 717-261-5711

Vendor
S & S Electric Motors, Inc. 125 Falling Spring Road Chambersburg, PA 17201

Ship To
Nutrient Control Systems, Inc 130 Industrial Drive Chambersburg, PA 17201

Email	Ship Via	Expected	Terms
		6/23/2022	Net 30

Description	Qty	Rate	Amount
PTS 15-150 08P00356CR Rebuild	1	0.00	0.00

Total		\$0.00
--------------	--	--------

NCS Equipment Repair Information Sheet

Customer Name NCS Inventory
Receipt/Drop Off Date 1/6/23/22
Model and Serial# PTS 15-150 08P00356CR
KW/HP 15
Site Voltage _____
Customer Complaint locked up
Service Requested repair
Voltage Requested 270/460
Repair Shop Name S85
Repair Shop Job/Tag Number ~~S85~~ 935252
Doris Ticket Number/PO# 7509-INV

Quantity

Repair Shop Parts Request

- ① 1. 1.00525 (7) mechanical seal
- ① 2. 1.00526 (11) mechanical seal
- ① 3. 1.00210 (14) bearing
- ⑥ 4. 1.00130 (20) screws
- ① 5. 1.00282 (37) oring
- ① 6. 1.00211 (38) bearing
- ① 7. 1.00313 (42) oring
- ① 8. 1.00314 (44) oring
- ⑥ 9. 1.00136 (46) screws

\$2563.88 to repair
needs rewound and new
oil.

Employee Requesting Service Turner Baker Date _____

INVOICE



S&S Electric Motors, Inc.

125 Falling Spring Road
 Chambersburg, PA 17202
 Phone: (717)-263-1919
 Fax: (717)-263-7351
 Web: www.sselectricmotors.com

INVOICE NUMBER 817708
 INVOICE DATE 2/20/2023
 PAGE 1

S 011294
 O NUTRIENT CONTROL SYSTEM
 L 130 INDUSTRIAL DRIVE
 D CHAMBERSBURG, PA 17201

S NUTRIENT CONTROL SYSTEM
 H 130 INDUSTRIAL DRIVE
 I CHAMBERSBURG, PA 17201
 P

T
 O

T
 O

Customer Contact:

NET DUE 2,670.13

SALES REP	SHIP DATE	SHIP VIA	TERMS	JOB NO	TRANS ID
100			00	00935252	00001444

CUSTOMER PO: 7509-INV

PO RELEASE:

MISC NUMBER:

NAMEPLATE DATA

HP:15 KW; MFG:CRIMAN; VOLTS:690-400; RPM:1740; AMPS:18.7-6.2; PHASE:3; MODEL:PTS15-150; SERIAL:08P00356CR

SPECIAL INSTRUCTIONS

CHECK OUT

HIPOT-FAILED & SURGE TEST POOR. MOTOR IS LOCKED UP. DISASSEMBLE & CHECKOUT. FOUND WATER IN SEAL CAVITY, WATER LEAKED INTO DE BEARING CAUSING BEARING FAILURE. ALL PARTS RUSTED AND CAME APART HARD. STEAM & BAKE WINDINGS. HYPOT WINDINGS-FAILED. FOUND WINDINGS DAMAGED DUE TO OVERHEATING. REPLACE SEALS/BEARINGS/ORINGS SUPPLIED BY CUSTOMER. REWIND STATOR, INSTALL NEW OIL, HOOK UP CORD USING ORIGINAL 9 LEAD CORD PER CUSTOMER REQUEST (CUSTOMER NOT USING OVERLOAD WIRES). REASSEMBLE & TEST.

DESCRIPTION / NOTES	LINKED JOB ID	UNITS	QUANTITY	UNIT PRICE	EXTENSION
REWIND STATOR/OIL/MISC	00935252	EA	1.0000	1,713.8800	1,713.88

Labor Subtotal

956.25

Material Subtotal

1,713.88

We appreciate your business.

TAXABLE	NONTAXABLE	FREIGHT	SALES TAX	MISC	TOTAL
0.00	2,670.13	0.00	0.00	0.00	2,670.13
PREPAYMENT	0.00			NET DUE	2,670.13

PAYMENT METHOD:

CHK# 15739

PAYMENT NO: